

INSPECTION DISCREPANCY LIST

MAKE: C **MDL:** 310 **YR:** **N#:** **DATE:**
AC S#: **ENG** **S#** **T/H** 2571
MAGS: **PROP:**

CHECK ELT DATE & CHECK OPERATIONAL FUNCTION
AW REG W/B POM DATA PLATES AF ENG
DEV CARD PLACARDS / ELT DATE FAR 91-207 CHECK

#E	1	Front Oil Pan Leak and Bottom of Coals	*	X	0
	2	No indication of AD complied with on Map C/W Per AD		X	3
	3	Prop Controllable at Governor Separated		X	0
	4	Prop Backing Plate Cracked Bad Behind Blade		X	10
	5	Air filter Completely missing Clean entire Area	(P)	X	25
	6	Upper Governor Mount at Eng Bad	(P)	X	0
	7	Exhaust clamp Missing Bolt & Pipe Some Separated @ 3/4		X	-1
	8	Broken Air filter Clamp - Missing Safety Wire (Fabricate Part)	(P)	X	0
	9	at cyl 4 Lower Spark Plug Lead Shallow Broken at Plug		X	N/A
	10	#1 cyl. exhaust crack	Remove (P)	X	1
	11	Prop seal leaks oil. (W/ENG)	(P)	X	N/A
	12	Lube pump governor control cable install large washer		X	0
	13	Safety Wire on head to throttle body bolts		X	0
	14	paint oil filler cap and main oil cap		X	2
	15	L/eng. 2 pads #6 cyl. missing 1 upper and 1 lower		X	10
	16	L/eng. replace eng weather hoses		X	0
	17	L/R. pictorial control board missing	N/A (P)	X	2.5
	18	Change oil, check oil screens. L/R. eng.		X	2.5

R. L. JOHNSON 1877678 1A

12

REMOVED

INSPECTION DISCREPANCY LIST

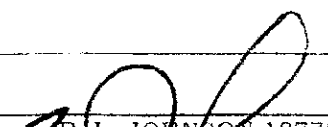
MAKE: C **MDL:** 310 **YR:** **N#:** 8145 M **DATE:**
AC S#: **ENG** **S#** **T/H** 4/03/02
MAGS: **PROP:**

CHECK ELT DATE & CHECK OPERATIONAL FUNCTION

AW REG W/B POM DATA PLATES AF ENG

DEV CARD PLACARDS / ELT DATE FAR 91-207 CHECK

- | | | | |
|----|---|---|----|
| 1 | Magh Fuel Filler Ports for Tank Capacity | X | 15 |
| 3 | 4/10 Side at Tail / Remove Corrosion around data plate | X | 20 |
| 4 | Check Up Entire Tail Area proper V fin & Rudder also Secure Wire for Tail Light | X | 02 |
| 5 | On Rudder Center Hinge / Clean up Corrosion and trim out the Tom Skin | X | 02 |
| 6 | Missing Rivet above #5 | ? | 02 |
| 7 | 4/10 HORIZONTAL STAB By center hinge TOP SIDE Remove Corrosion | X | 02 |
| 8 | Rudder Trim Tab along hinge / Remove Corrosion also at Bottom of Rudder / Fixed - Corrosion | X | 02 |
| 9 | 4/10 Elevator, trailing Edge Broken | X | 2 |
| 10 | Corrosion along Bottom edge of dorsal fin | X | 2 |
| 10 | Corrosion on side of fuselage By baggage door (REF) | X | 2 |
| 11 | Top Fuselage Root AT Antenna | X | 2 |
| 12 | Clean Corrosion and replace ADF Antenna Spring | X | 20 |


 R. L. JOHNSON 1877678 IA

AS CHECKED

INSPECTION DISCREPENCY LIST

	MAKE:	MDL:	YR:	N#:	DATE:	APT:
	AC S#:	ENG MDL		S#	TAC/HOBBS	
	MAGS:			PROP:		
1	CHECK ELT DATE & CHECK OPERATIONAL FUNCTION					
	compression test L/eng 1/70 2/70 3/70 4/78 5/70 6/72					
	R/eng 1/72 2/64 3/70 4/68 5/72 6/72					
	Open aircraft for annual; clean aircraft.					6.0
	# Fuel press gage snap					0.5
	R main light snap.					.15
	service brakes.					
	Wash and degrease eng					2.0
	Clean repack wheel bearing Wash, clean gear Wash.					2.0
	Clean paint rusty parts on gear-					2.0
	Install cotter Key. New gear cleare rod ends.					10.0
	Comply w/AD # 72-15-08 L/R engin					1.0
	Flex hoses - AD # 75-25-13					B.J
	oil filter AD # 88-03-06 01 L/R eng.					0.5
	oil, pickup tube AD # 93-08-17 L/R eng.					1.0
	Cyl Val Retainer AD # 93-10-02 left, right eng.					3.0
	Crank Failure. AD # 99-19-01 left, R eng					1.0
	Exh Roller R ARM. AD # 98-01-08 L/R eng.					1.0
	Mag coils AD # 94-06-09 L/R eng. L/eng replaced					3.0
	Log book entries					1.0
						24.5