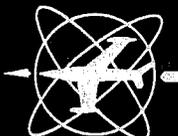


The Standard
 **ENGINE LOG**

ASA-SE-2

Left Engine

YEAR DATE	RECORDING TACH TIME	TODAY'S FLIGHT	TOTAL TIME IN SERVICE	Description of Inspections, Tests, Repairs and Alterations Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)
7-7	2767		UNKN	15MST 114 OIL CHANGED 11QTS PHILLIPS 20W50 OIL ADDED FILTER CUT OPEN - INSPECTED FOR METAL NONE PRESENT COMP CHECK 1 2 3 4 5 6 6 7/8 CND WITH AD OS. 14-07 BY INSPECTION / CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED AND A 100HR INSPECTION AND WAS DETERMINED TO BE AIRWORTHY


[Signature]
[Redacted]

REG#	N59773		LAKESHORE AVIATION MANITOWOC COUNTY AIRPORT [Redacted] MANITOWOC, WI 54220	DATE	7/28/2011
			HOBBS	2827	

CHANGED ENGINE OIL AND FILTER. SERVICED THE ENGINE WITH 11 QTS OF PHILLIPS 20W50 X/C OIL AND AN AA48103-2 FILTER. CUT OPEN THE OLD OIL FILTER AND INSPECTED IT FOR METAL PARTICLES- NONE NOTED AT THIS TIME. INSTALLED NEW INTAKE SEAL P/N 72711 AND GASKET P/N 71973 TO #2 CYLINDER INTAKE TUBE. RUN UP AND LEAK CHECK OKAY.

JEREMY TROUSIL [Redacted] A&P [Redacted]

100 hr

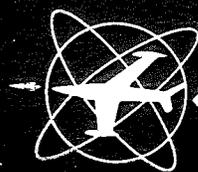

The Standard

ENGINE LOG

ASA-SE-2

Right Engine

YEAR
20
DATE

RECORDING
TACH
TIME

TODAY'S
FLIGHT

TOTAL
TIME IN
SERVICE

Description of Inspections, Tests, Repairs and Alterations

Entries must be endorsed with Name, Rating and Certificate Number of Technician or Repair Facility. (See back pages for other specific entries.)



Certified Repair Station E57R246V

[Redacted]

LOGBOOK ENTRY

Date: 11/10/2011 Model: LTIO-540-J2BD S/N: L-1701-68A E4991

Disassembled engine for inspection. Cleaned all parts. Magnafluxed and Zygloed all parts. Crankshaft ultrasonic test by Phil's Cylinders Service. Assembled engine with new gaskets, crankshaft gear bolt, c/w blade bushings, c/w pins, c/w plates, c/w rings, rod bolts, rod nuts, main bearings, rod bearings, mag cushions, oil drain tubes, oil pump housing, and (1) thru bolt. Installed regrind lifters bodies and exchanged same type regrind camshaft. Honed cylinders for ring finish, cleaned pistons, cleaned valve guide and installed new rings. All other parts were of serviceable condition and used over. All work done according to parts and overhaul manual. Ran engine in test cell to check operations. This engine is in serviceable condition and is returned for service. A list of parts and AD, SB compiled with supplied in logbook. END

[Redacted]

Steven A Warr, Inspector

