


CW 248  
 Lot # 2-13-97-112  
 Dredged Z-4085

Wing Center Section  
 Lower skin segment  
 RBL 3 to 13 At Mid Spar

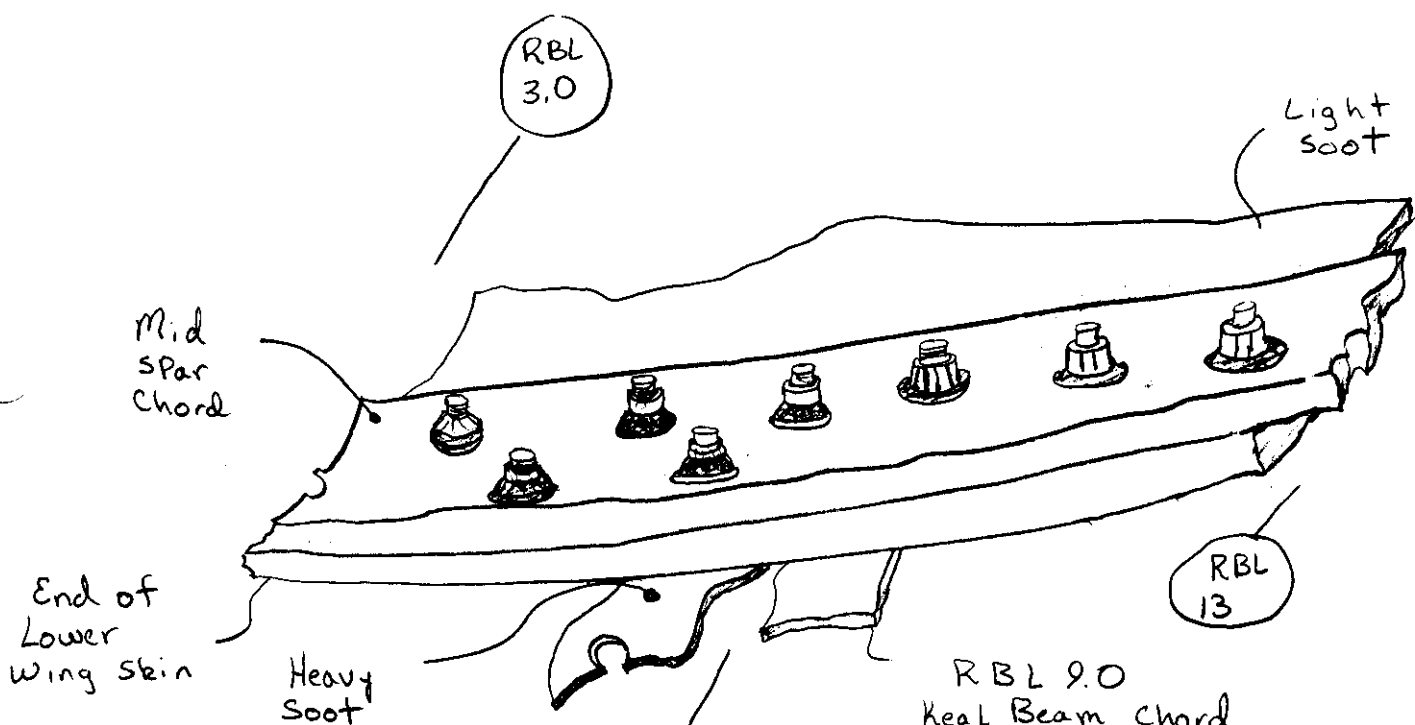

- Mates to all surrounding surfaces
- Light Areas of Soot on inside Surface
- Heavy Soot on exterior surface.
- Soot on exterior surface of skin in the area that the RBL 9.0 Keel Beam Chord would normally Cover
- Fracture Surfaces are either sooted or oxidized
- No slow growth fracture surfaces

4A Report  
 4/8/97 ALPA

Denise Santiago IAM  
 4-8-97

4/11/97  
 TWA 4-8-97

Jim Powers  
 4-1-97 Boeing  
 Tom Todaro  
 FAA 4-10-97