SPANWISE BEAM # 3

CW-609 C-2671 GREEN

This is a small section of the web which attaches to the upper corner of CW601. This section experienced heavy fire damage and the web is bent slightly aft.

Tom Toduc FAA 10-29-96

S.D GREEN 10-29-96


ALPA Miplo 11-26-96 C) Hal- 11-27-96 IAM

Rear View

PART HEAVILY

SOOTED ALL

SIDES

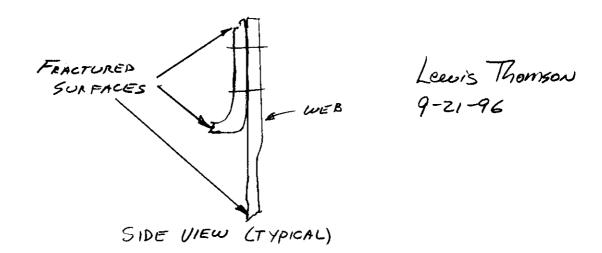

WEB FRACTURE-

AND BENT

AFT

UNIQUE FRACTURE

FRACTURE FACE

ON C868

DETAIL MATCHES