

LOG # LF100

TAG  
TARGET # X4078

COORD: LAT \_\_\_\_\_

LONG \_\_\_\_\_

DEBRIS FIELD Red Trawl

11-23-96-149

T7846

STA 920 Frame Segment  
from S-29L to S-32L

Lowermost aft frame segment that matches with Red debris "curled" panel LF5. At this location, the Green debris skin panels start approximately 2 inches aft of the STA 920 frame station.

The shear tie flanges are fractured off and remain attached to LF5 skin. The segment is straight and flat.

There is no evidence of fire damage or sooting.

Tom Tolino  
FPA 3-21-97  
Veig J. Simon - ALPA  
3-19-97


Dennis Hartigan IAM  
3-24-97  
D. Hartigan  
TOA 3/19/97

S. Chisholm  
1/19/97

LF100

Red trawl area  
11.23.96-149

Matches piece  
from LF5

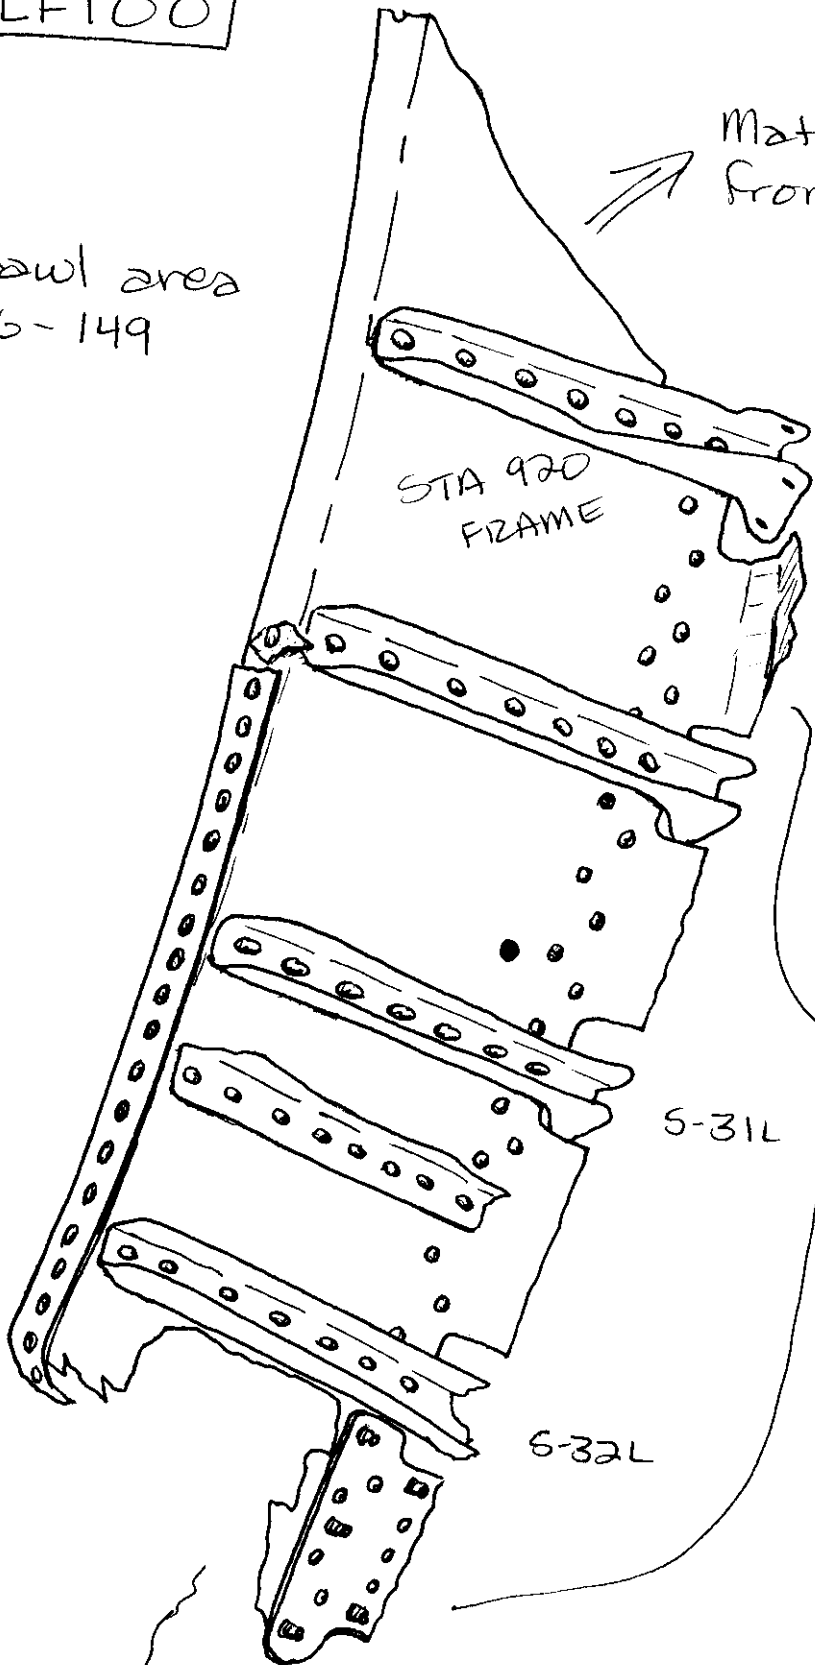

S-29L

S-30L

S-31L

S-32L

Shear ties  
remain on  
LF5 skin

LF 70A skin  
(Green)

LF5 skin (Red)

VIEW LOOKING AFT

S. Christoh  
11/9/97