


Left Wing

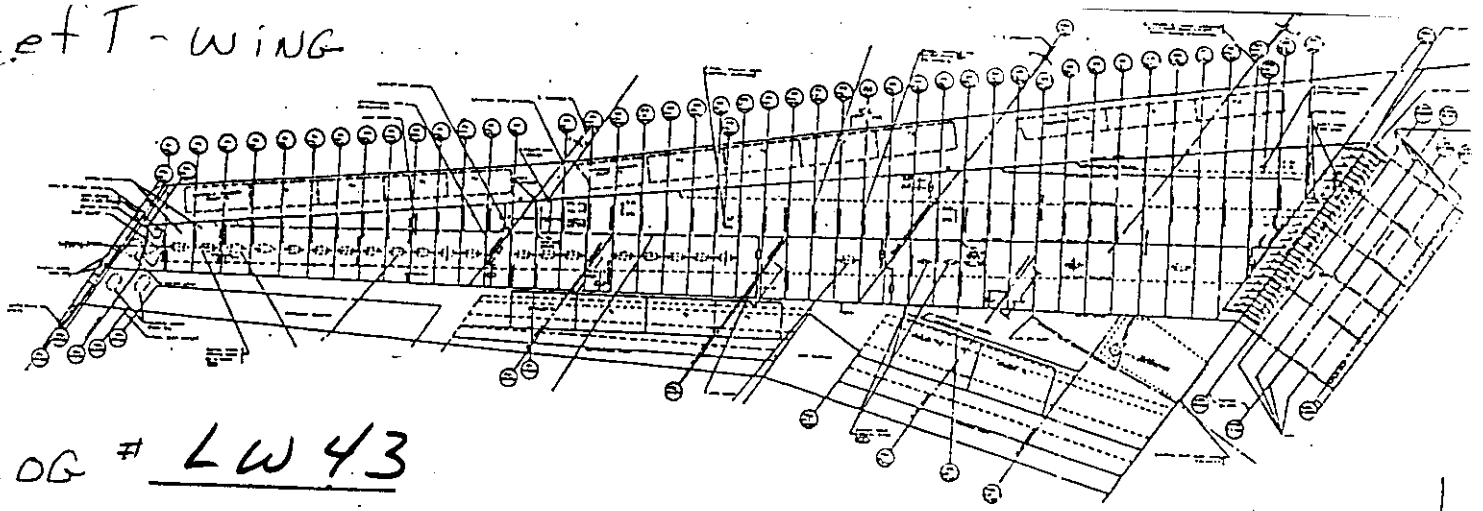

LOG # LW 43


TARGET # 23083

COORD Lat: _____

LONG: _____

Debris Field GREEN TAG # Z3083

LEFT WING FLAP TRACK S/N 0583.
 #2 POSITION TRACK IS INTACT. CARRIAGE IS ATTACHED
 ALONG WITH GEAR BOX AND JACK SCREW. JACK SCREW
 IS SEVERED AT ~~THE~~ LOWER END OPPOSITE END OF GEAR BOX.
 TRACK IS CRACKED IN SEVERAL PLACES. NO BURNING
~~IS~~ IS EVIDENT BUT THERE IS SOME SOOTING.
 ALL INDICATIONS IS THAT FLAP WAS RETRACTED.

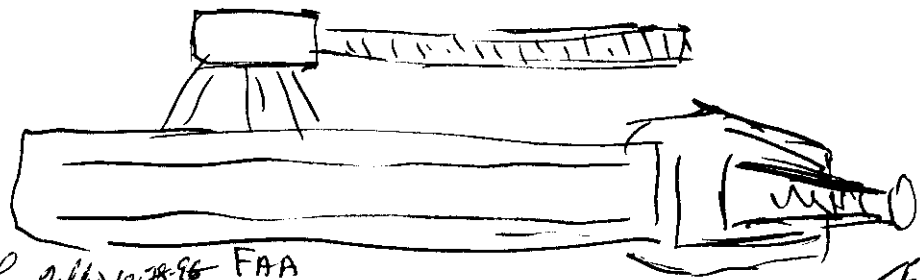

Lee Zibko 10/28/96 FAA
 TMSing 10/13/96 - TWA

SJ GREEN - ALPA
 11/16/96
 D. Santiago - TAM
 11/17/96
 - NTSB

PA MAROTTE
 FAA
~~PA~~ - BOSU
 ✓