


LOG # RF79
 TARGET # _____
 COORD: LAT _____
 LONG _____

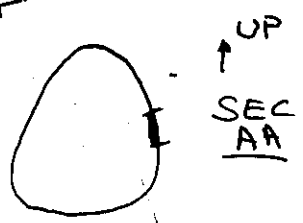



DEBRIS FIELD YELLOW

SECTION OF SKIN WITH WINDOW REMOVED.
 WINDOW POSITION IS # 11 RIGHT SIDE OF
 AIRCRAFT SLIGHTLY BEFORE STATION 340 TO
 STATION 360. SKIN HAS TEARING AND
~~TEARING~~ HAS NO TAGS ONLY DATE. 8-7-96-15
 THERE IS NO SIGN OF FIRE DAMAGE OR
 SOOTING. 3ft by 2ft
 Strips 5-19 - 5-22

P. Marotte
 FAA
 9-15-96 came from
 yellow zone

revised
 9-15-96
 Henry Missel
 Boeing

RIGHT
 SIDE

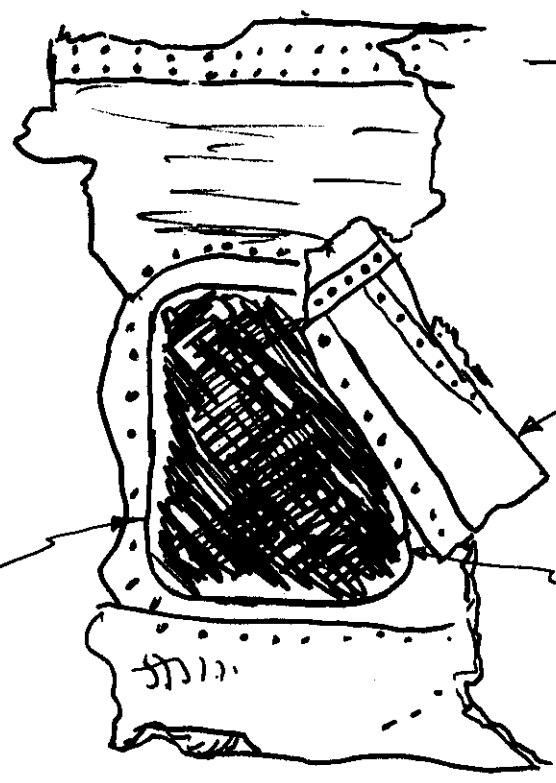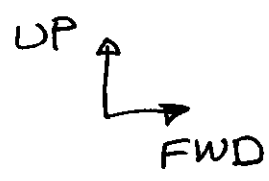


window forging,
 inner flanges,
 torn

skin
 bent
 out and
 back

window forging,
 inner
 flange,
 is
 buckled

2 1/2
 Dennis Bartlett IAM
 10-25-96

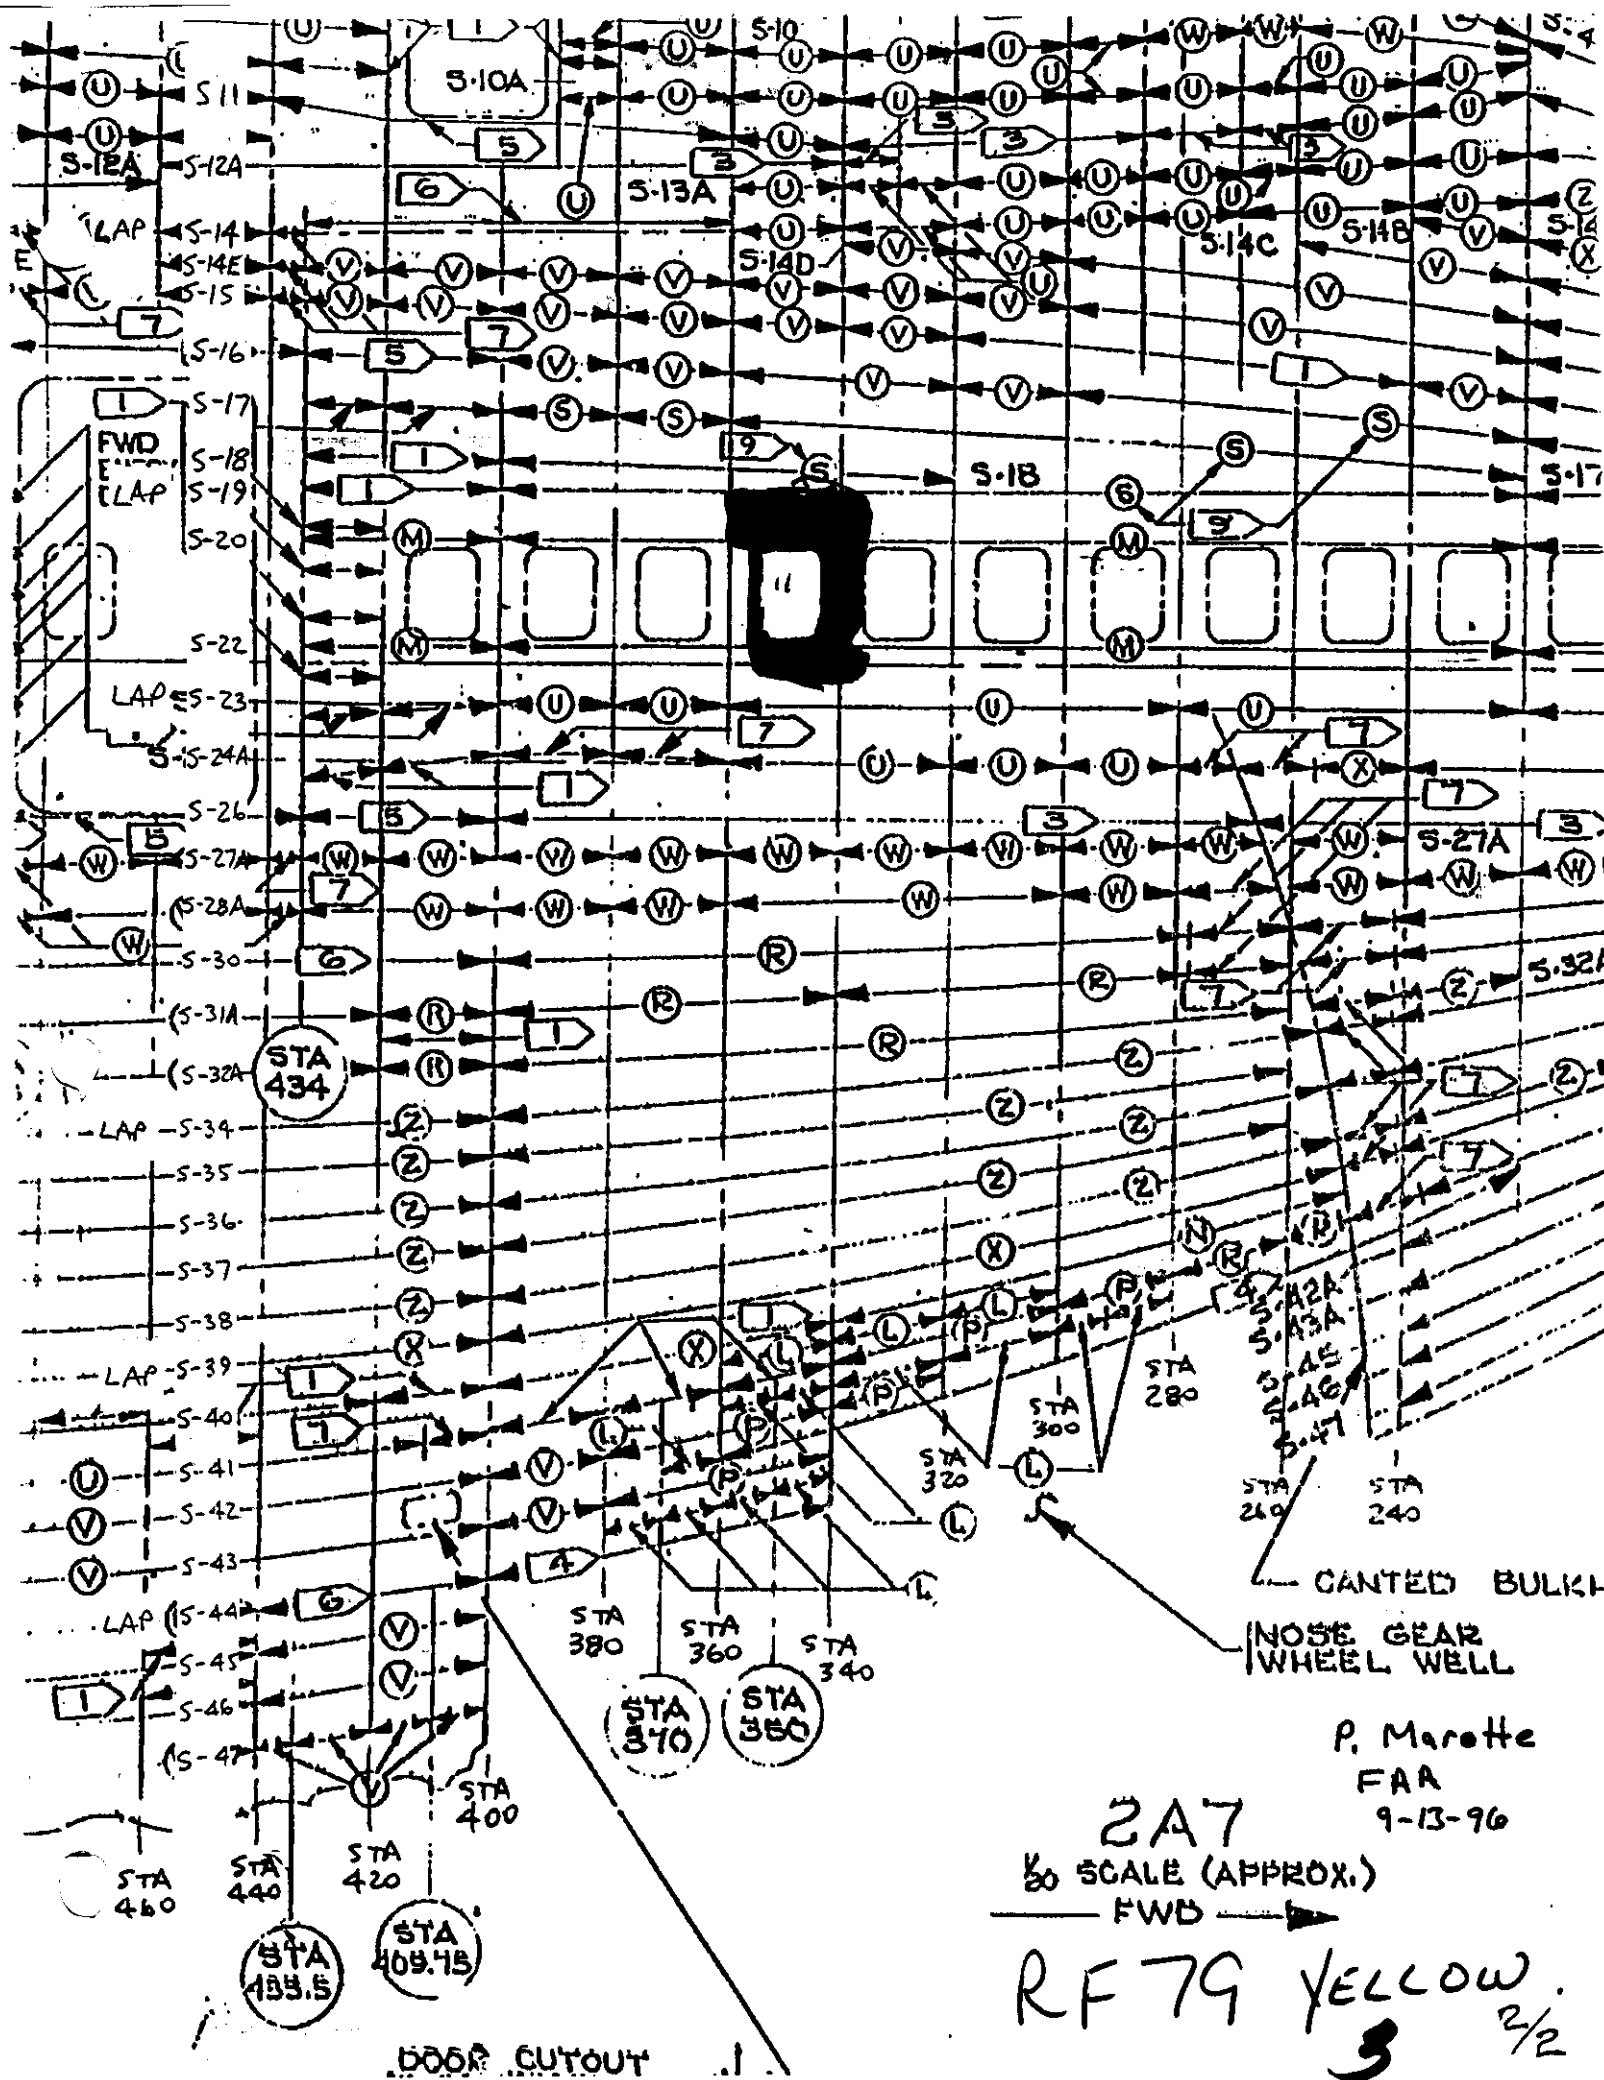

2A7
 1/80 SCALE (APPROX.)
 FWD →

RF 79 YELLOW
 3 2/2

P. Marotte
 FAR
 9-13-96

DOOR CUTOUT