


RH UPPER SKIN SEGMENT - WS1260 to
WS1290, S-7 to S-12

RW39

Lot No: 1-24-97-6

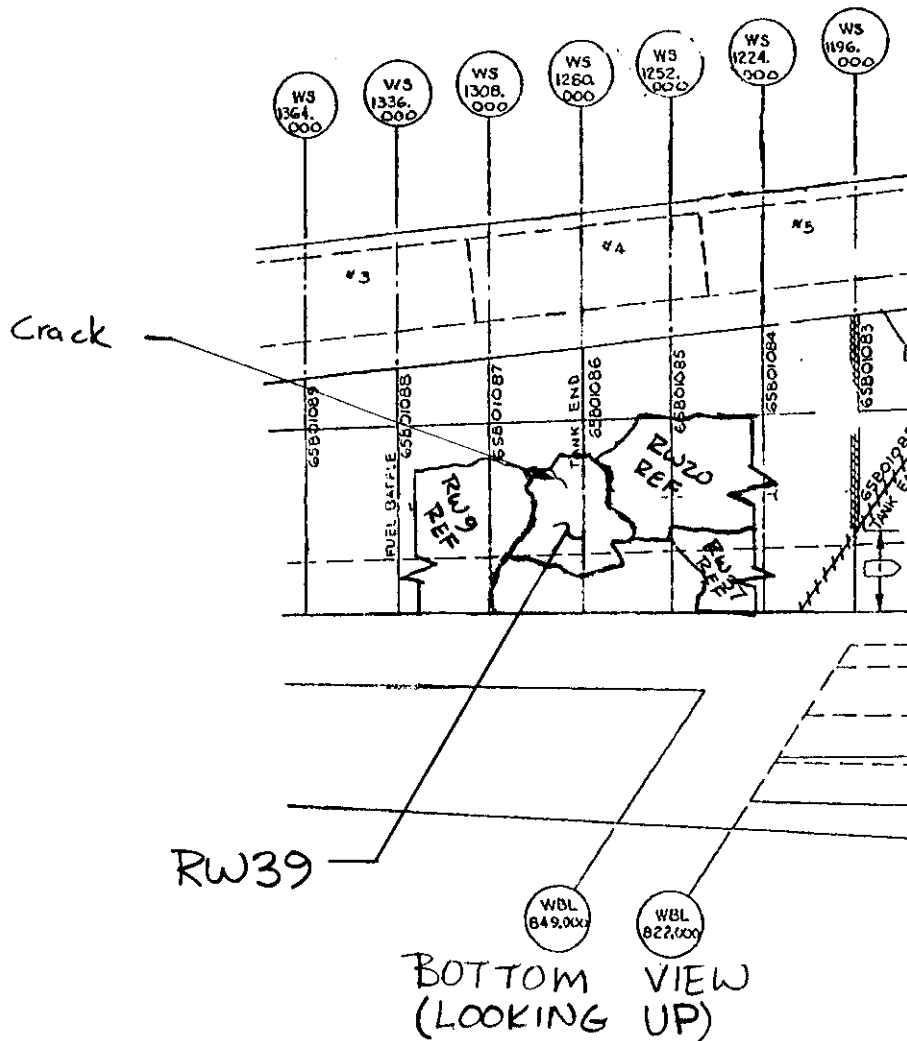

Green Zone
TAG # Z4035

This segment of upper skin extends from approx WS1260 to WS1290 and encompasses S-7 to S-12

Part is relatively flat with some slight out of contour bends
Seoting was not detected on any surface.

Fracture surfaces show signs of salt water corrosion.

Fuel tank primer was gone from fwd inbd portion of segment.

A four inch crack was observed on the fwd outb area.

No pre-existing damage was observed.

Segment edges had areas with delamination fractures.

D. James
1/29/97

B. W. ...
TWA 3/22/97

Dennis ... IAM
4-3-97

Stephen ...
17M 04-03-97

Leigh D. ...
3-22-97