


San Francisco Parker Avenue at Geary Blvd.

Natural Gas Distribution Pipeline Strike

Incident Date: 2/6/2019

SF Parker/Geary Event Sequence/Timeline

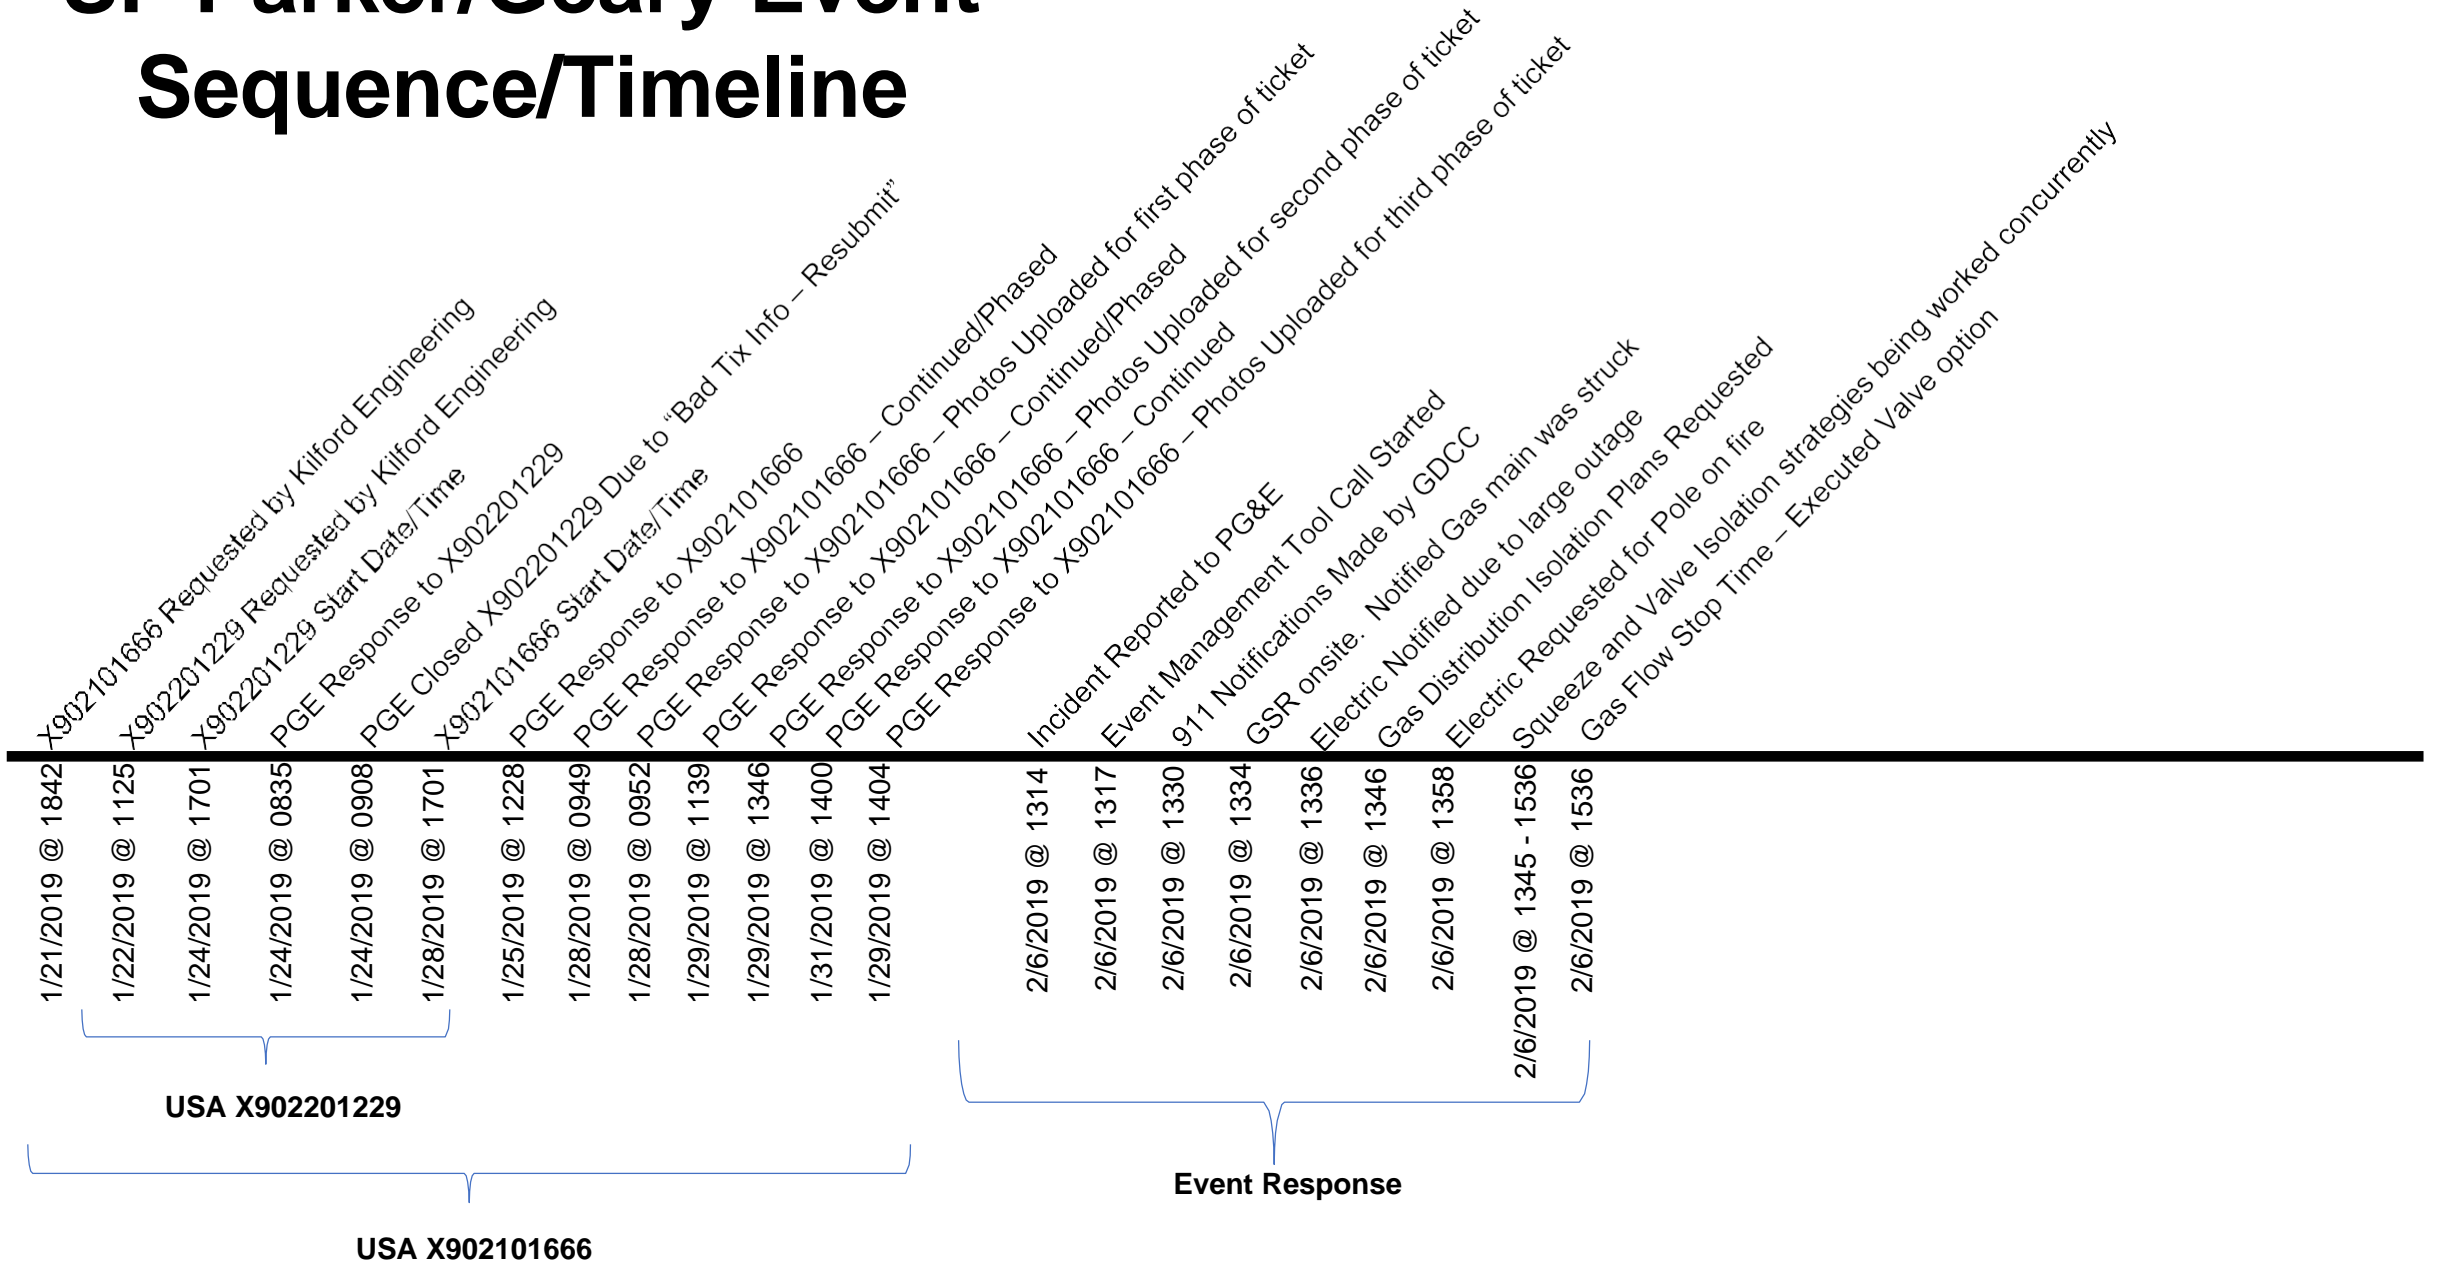

USA X902201229

USA X902101666

Event Response

Kilford Engineering called in two USA tickets for this site.

PG&E responded to USA Ticket #X902201229 on 1/24/2019 at 0835 hours and discovered the existing delineations did not match the description on the USA ticket. See description

below:

Street Address: GEARY BLVD
Cross Street: PARKER AVE

WORK ON THE NORTH SIDE OF GEARY BLVD STARTING AT PARKER AVENUE, GO 100 FEET WEST ON GEARY BLVD. WORK EXTENDS 40 FEET INTO THE STREET AND 10 FEET INTO THE PROPERTY FOR THE DISTANCE

Place: SAN FRANCISCO County: SAN FRANCISCO State: CA

The locator electronically responded to this ticket at 0908 hours and photographed the delineations. He documented that the delineations did not match the work location description and closed the ticket with an advisement for the excavator to correct the issue and resubmit the ticket. See Below for the response.

EXCAVATOR POSITIVE RESPONSE NOTES:

Description of work area does not match delineated area. Delineation starts on Presidio ave on No pge electric side of Geary Blvd and goes east to east side of Emerson. Total of 6 BLOCKS. Pls delineate area probably with accurate info on ticket. Also specify start point. Any questions pls call Santiago at (415) 730-1646

PG&E responded to the second USA Ticket (#X902101666) on 1/28/2019 at 0949 hours. The work location description had now changed to match the actual delineations present at the site. See description below. The facilities were marked and photographed.

Location:
Street Address: GEARY BLVD
Cross Street: EMERSON ST
2nd Cross St: PARKER AVE

Side: N

WORK IS ON THE NORTH SIDE OF GEARY BLVD FROM EMERSON ST TO PARKER AVENUE.
EXTEND 40FEET INTO STREET AND 10FEET INTO PROPERTY FOR ENTIRE DISTANCE

Place: SAN FRANCISCO County: SAN FRANCISCO State: CA

