



VEHICLE FACTORS ATTACHMENT

Trailer Maintenance Records

Teutopolis, IL

HWY23MH017

(3 pages)

Trailer 10 Air Schematic

Front

August 2022
Rewired trailer
New Air lines

Key

P → Red Gladhand


P → Blue Gladhand

— → 1/2" Air

- - - → 3/8" Air

- - - → Brake Line

Subframe
↓

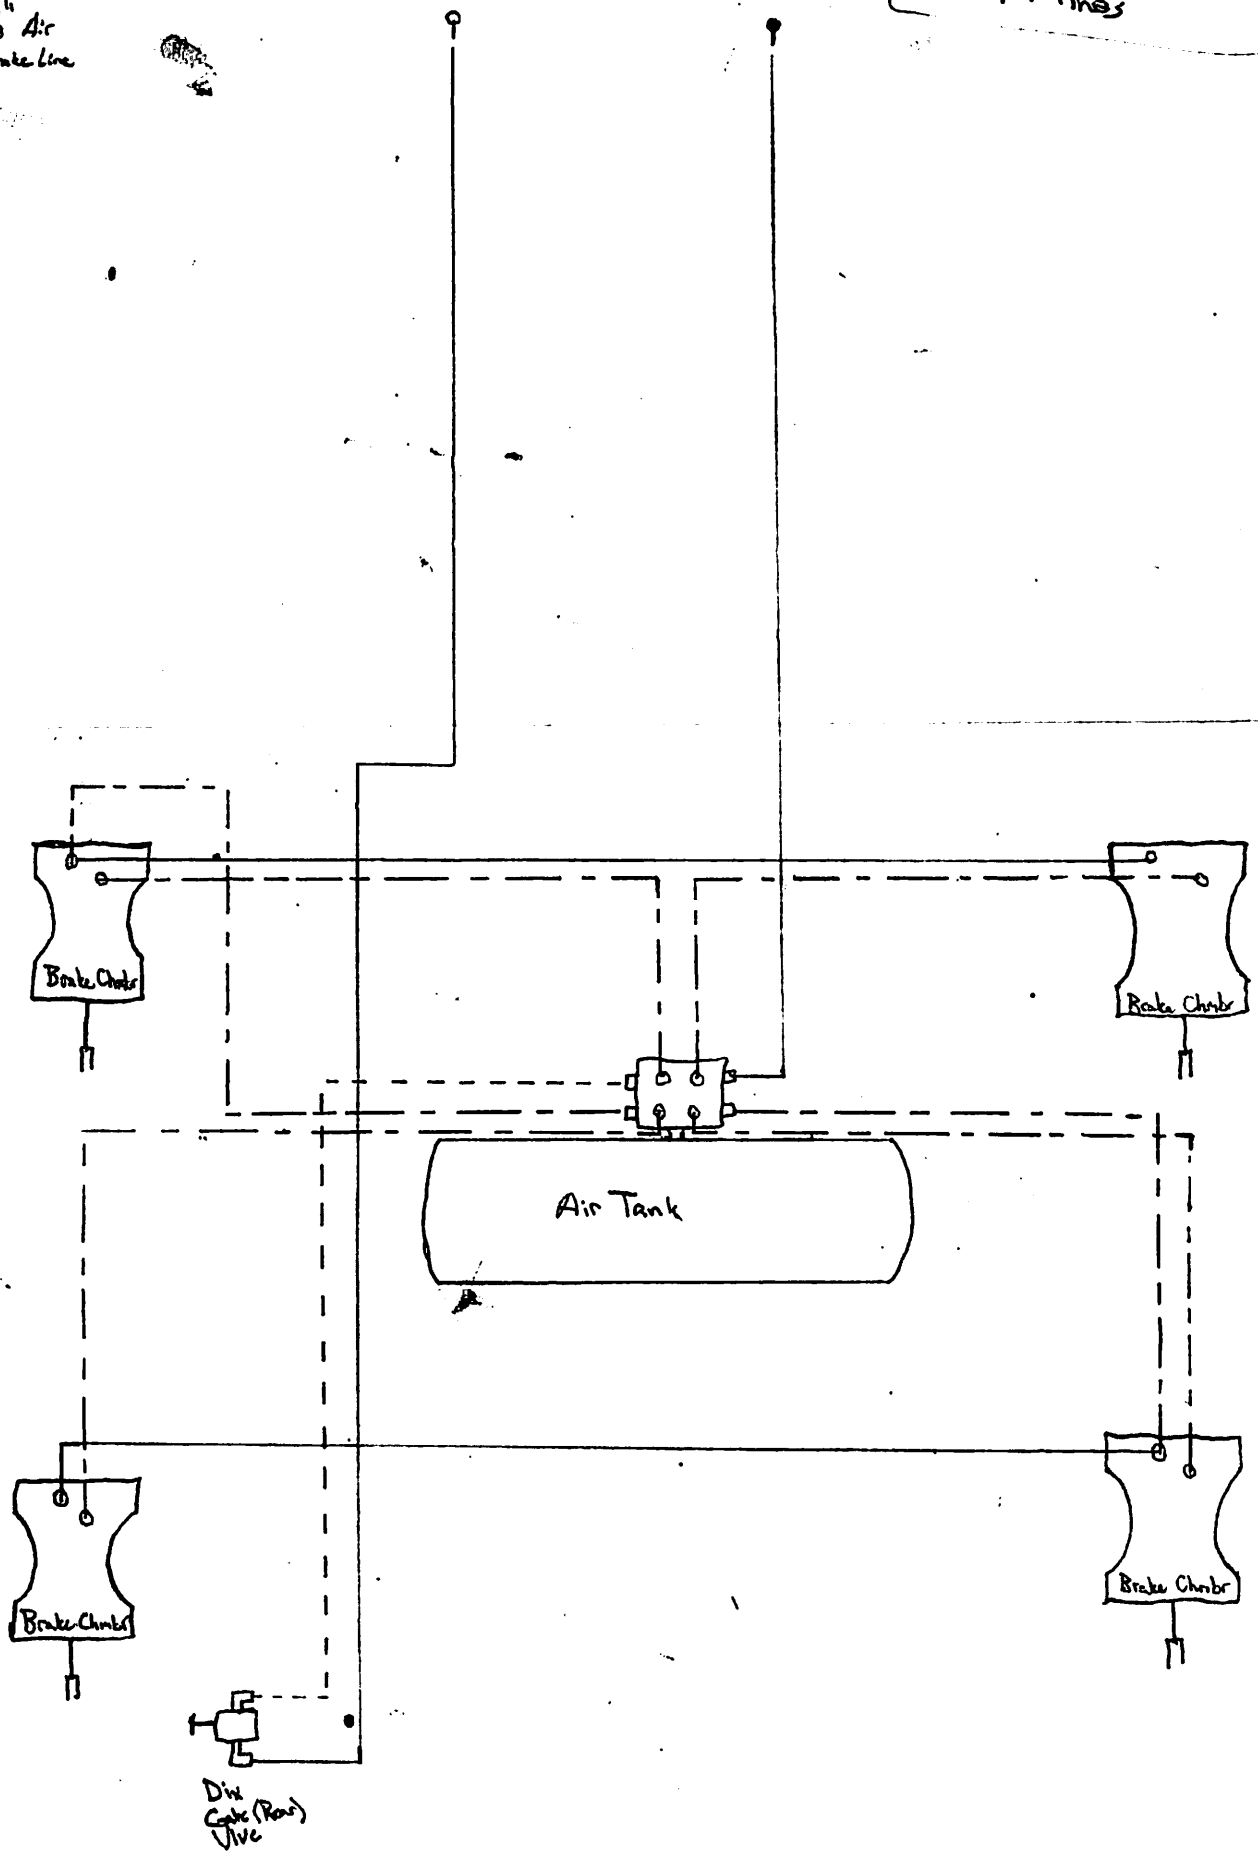

Technician Name	Date of Completion	Function Performed	Part Brand
	3/21/2022	Alignment	
	6/23/2022	Install new junction box	Truck-Lite
	6/28/2022	Straightened pass light box hanger	
	6/28/2022	Removed driv hose tube	
	6/30/2022	Install new light boxes rear	
	7/1/2022	New lights at rear	Grote
	7/1/2022	New clearance lights at front	Trux
	7/1/2022	New clearance light bar on top	Grote
	7/1/2022	New mid-trailer clearance/turn signal lights	Abrams
	7/1/2022	Install tracking device	
	7/1/2022	New beehive lights on rear lightbox	
	7/1/2022	Install new trailer plug box	Hal dex
	7/11/2022	New main emergency and service airlines from front	Grote
	7/12/2022	New dixie gate	Civacon
	7/12/2022	New hose tube pass side	
	7/12/2022	New decals on bumper	
	7/12/2022	New QT decal front	
	7/12/2022	New DOT Conspicuity strip front pass	
	7/13/2022	New landing gear	Jost
	7/15/2022	Blew down	N/A
	7/18/2022	Rebuilt spray fill quarter turn	Jomar
	7/19/2022	Installed new liquid internal rear	MEC
	7/26/2022	Installed new Samsara tracker	Samsara
	7/28/2022	Install new vapor internal front	MEC
	7/28/2022	Remade bleed down system front, exception of pass 1/2" quarter turn	
	4/3/2023	New seal in rear pump head	Blackmer
	4/3/2023	New bearing in rear pump head	Blackmer
	4/3/2023	New head oring rear pump head	Blackmer
	4/3/2023	New oring in plumbed discharge flange	Blackmer
	4/3/2023	New ujoint on pump PTO shaft	Napa
	4/3/2023	New keyed shaft for pump PTO	
	4/3/2023	New pillow block carrier bearing for pump PTO shaft	Napa